

SSI_ACT settings that has solved the Activator dongle problem ("hardware lock (dongle) is missing")



SSI_ACT			OS	CPU model	CPU MHz	PC model	DDINST32.EXE suggested	Comments	BIOS LPT1 setting	Activator-M type 1 or 2*
X	Y	Z								
10	10	10	win95		266	WinBook XL laptop			ECP	1
10	10	20	win95	P3	500					1
10	10	50	NT4	P3	800					1
10	10	60	win98		450		2,2,12			1
15	15	15	win9x	P2	300					1
20	20	20								1
20	20	40								1
20	20	40	win95	P2	200					1
10	10	40	win95	P2	233					1
20	20	70	win2000		866	IBM NetVista	2,2,7			1
30	30	50								1
50	50	100	win95	P2	500					1
100	100	100	win95	P2	266					1
100	100	100	win98					EW-OK, DOS failed		1
100	100	100	win98	AMD K6	266					1
100	100	100	win9x	AMD K6	233					1
100	100	100	win98		450					1
100	100	200								1
100	100	400	NT4	P3	733	Dell OptiPlex GX110	2,3,7 or 3,3,7			1
100	100	600	win98	AMD K?	500		2,2,12			1
200	200	300								1
300	300	300								1
350	350	350								1
400	400	400								1
400	400	500	win98	P3	550					1
10	10	90	win98	P3	600		2,2,17			1
200	200	500		P3	700	IBM ThinkPad	2,2,17			1
200	200	400					2,2,15			1
20	20	150		P3	866					1
10	10	20	win2000	P4	1500					1
20	20	40		AMD Duron	800			Motherboard: VIA-663AS ULTRA		1
800	800	800	XP		1600	Siemens Scenic	2,2,15			
100	100	1000	WinXP	AMD Athlon	1000		2,2,25	ASUS motherboard		
10	10	20	win-2000	p4	1500			call_45339		

150	150	250	win2000	P4	2400	Compaq			call_50434		
100	100	200		Pentium 4	1.8MHz	HPC			call_57828		
500	500	500	winXP						call_62540		
150	150	250	winXP	P4	2800	Dell Dimension 8250		10,10,20	call 63435		
150	150	250	win2000	P4	2400				call 65488		
150	150	250	winMe	P3	866	Compaq			call 66392		
150	150	250	win2000	AMD Athlon	1800			2.2,70	call 78456		
4	4	160	XP	AMD Athlon	1600			2,2,80	call 89042		
3	3	105	XP SP2	P5-530	3000	HP		2,2,70	2005-10-21, internal, IPEO		
200	200	200	XP SP2	P4	3000	HP			call 99727s		
150	150	250	XP SP2	P4	3000				call 101942		
100	100	200	XP SP2	p4	3000	hp		10,10,20	call 125460		

For further info, please read tech note @ <http://www.iar.com/support/?note=98236>

=====

IAR Systems AB - Technical Support

Tel: +46 18 167 800 [e-mail: support@iar.se](mailto:support@iar.se)

<http://www.iar.com/Support/EW>

Different Architectures - One Solution

8 - 16 - 32 bit

=====

2002 INIL

2009 IMAL

* type 2 is the 10 dongles Nick has received from Rainbow for test purpose.